

MARION COUNTY SURVEYOR'S OFFICE


SECTION CORNER RECORD

DEBRA S. JENKINS
MARION COUNTY SURVEYOR


SEC. 18 TWN. 17_N RNG. 5_E

BRYAN F. CATLIN, PLS
TECHNICAL SUPERVISOR

Date: 5-12-09
Party Chief: Wilcoxen
Crew: Finney
Type of Marker: Harrison
Method of Establishment: County: 1-15-1985
IN S.P.C. E Zone, NAD 83
Name: 17051804
N: 518 671.674 0(m)
E: 70 330.128 0(m)

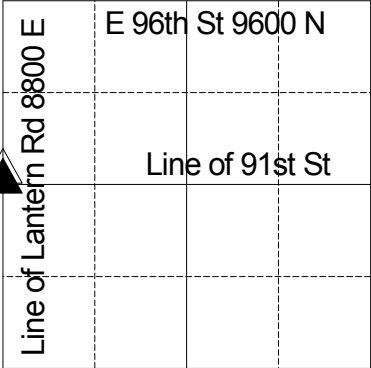

GinnyLock Dr

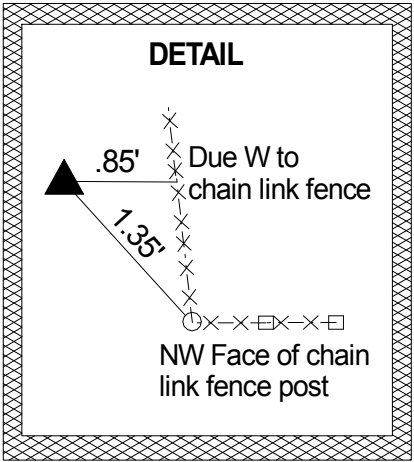

8741
GinnyLock Dr

8751
GinnyLock Dr

8817
GinnyLock Dr

Mini
Barn

3.

75.74'

8724
Powderhorn Ct

8718
Powderhorn Ct

21.00'

27.50'

8730
Powderhorn Ct

Powderhorn Ct

8727

No point set in original survey. Legal survey by Alexander Wilson in August of 1854 per Lawrence Township Legal Survey Book p.8 calls for a stone. No falling is indicated to the East Quarter of 13-17-4. Weihe Engineers Job #73-1045 calls for a stone fd at the West Quarter and an iron pin at East Quarter of 13-17-4. A falling of 75.74' is given. 3/25/1976 Wilcoxen ties West Quarter of 18-17-5 (stone) to East Quarter of 13-17-4 (angle iron) with a falling of 75.55' on both tie sheets. Plat of Hunter's Glen indicates a falling of 75.74' between corners but no description of either corner is given. 6/9/79 Bruer called an angle iron and indicated a falling of 76.36'. West Quarter corner is noted as being a rebar at a northerly corner of Lot 60 in Hunter's Glen. Subsequent work by Weihe indicates rebars at both locations with a falling of 75.74'. Corner excavated 8/10/1982 by Green. Stone referred to in previous ties was not found. No other markers found. Harrison set. 2/29/2000 Kiste retied. 5/12/09 Wilcoxen retied.

REF.	DISTANCE	DESCRIPTION
1.	27.50'	NE corner of wood on garage 8730 Powderhorn Ct
2.	21.00'	NW corner of brick on garage 8730 Powderhorn Ct
3.	75.74'	Due N to 17041306 (capped rebar)